



# GPL Odorizers GPL750 Missing Authentication for Critical Function

[MITRE](#)[NVD](#)[CVE.ORG](#)[JSON API](#)[Print: PDF](#) 

## Summary

<b>CVE</b>	CVE-2026-4436
<b>State</b>	PUBLISHED
<b>Assigner</b>	icscert
<b>Source Priority</b>	CVE Program / NVD first with legacy fallback
<b>Published</b>	2026-04-09 20:16:27 UTC
<b>Updated</b>	2026-04-13 15:02:27 UTC
<b>Description</b>	A low-privileged remote attacker can send Modbus packets to manipulate register values that are inputs to the odorant injection

## Risk And Classification

**Primary CVSS:** v3.1 8.6 HIGH from ics-cert@hq.dhs.gov

**CVSS:** 3.1/AV:N/AC:L/PR:N/UI:N/S:C/C:N/I:H/A:N

**EPSS:** 0.000630000 probability, percentile 0.197060000 (date 2026-04-15)

**Problem Types:** CWE-306 | CWE-306 CWE-306

Version	Source	Type	Score	Severity	Vector
3.1	ics-cert@hq.dhs.gov	Secondary	8.6	HIGH	CVSS:3.1/AV:N/AC:L/PR:N/UI:N/S:C/C:N/I:H/A:N
3.1	CNA	CVSS	8.6	HIGH	CVSS:3.1/AV:N/AC:L/PR:N/UI:N/S:C/C:N/I:H/A:N

## CVSS v3.1 Breakdown

Attack Vector

Network

Attack Complexity

Low

Privileges Required

None

User Interaction

None

Scope

Changed

Confidentiality

None

Integrity

High

Availability

None

CVSS:3.1/AV:N/AC:L/PR:N/UI:N/S:C/C:N/I:H/A:N

### Vendor Declared Affected Products

Source	Vendor	Product	Version	Platforms
CNA	<a href="#">GPL Odorizers</a>	<a href="#">GPL750 XL4</a>	affected v1.0 v6.0 custom	Not specified
CNA	<a href="#">GPL Odorizers</a>	<a href="#">GPL750 XL4 Prime</a>	affected v4.0 v6.0 custom	Not specified
CNA	<a href="#">GPL Odorizers</a>	<a href="#">GPL Odorizers GPL750 XL7</a>	affected v13.0 v20.0 custom	Not specified
CNA	<a href="#">GPL Odorizers</a>	<a href="#">GPL Odorizers GPL750 XL7 Prime</a>	affected v18.4 v20.0 custom	Not specified

### References

Reference	Source	Link
<a href="https://lincenergysystems-my.sharepoint.com/:f:/p/h_baer/IgDYaHlhXpyLQJvnKPd6b80TAUgV7Lp8qmVYBFUb0lmr7ak">lincenergysystems-my.sharepoint.com/:f:/p/h_baer/IgDYaHlhXpyLQJvnKPd6b80TAUgV7Lp8qmVYBFUb0lmr7ak</a>	<a href="mailto:ics-cert@hq.dhs.gov">ics-cert@hq.dhs.gov</a>	<a href="#">link</a>
<a href="https://www.cisa.gov/news-events/ics-advisories/icsa-26-099-02">www.cisa.gov/news-events/ics-advisories/icsa-26-099-02</a>	<a href="mailto:ics-cert@hq.dhs.gov">ics-cert@hq.dhs.gov</a>	<a href="#">www</a>
<a href="https://github.com/cisagov/CSAF/blob/develop/csaf_files/OT/white/2026/icsa-26-09...">github.com/cisagov/CSAF/blob/develop/csaf_files/OT/white/2026/icsa-26-09...</a>	<a href="mailto:ics-cert@hq.dhs.gov">ics-cert@hq.dhs.gov</a>	<a href="#">github</a>
CVE Program record	CVE.ORG	<a href="#">www</a>
NVD vulnerability detail	NVD	<a href="#">nvd</a>

### Vendor Comments And Credit

#### Discovery Credit

**CNA:** An anonymous researcher reported this vulnerability to CISA. (en)

### Additional Advisory Data

#### Solutions


**CNA:** GPL Odorizers recommends users update to the latest software version of the GPL750 in connection with the latest firmware from Horner Automation for the XL4, XL4 Prime, XL7, and XL7 Prime devices. [https://lincenergysystems-my.sharepoint.com/:f:/p/h\\_baer/IgDYaHlhXpyLQJvnKPd6b80TAUgV7Lp8qmVYBFUb0lmr7ak?e=JLeADm](https://lincenergysystems-my.sharepoint.com/:f:/p/h_baer/IgDYaHlhXpyLQJvnKPd6b80TAUgV7Lp8qmVYBFUb0lmr7ak?e=JLeADm). [https://lincenergysystems-my.sharepoint.com/:f:/p/h\\_baer/IgDYaHlhXpyLQJvnKPd6b80TAUgV7Lp8qmVYBFUb0lmr7ak?e=JLeADm](https://lincenergysystems-my.sharepoint.com/:f:/p/h_baer/IgDYaHlhXpyLQJvnKPd6b80TAUgV7Lp8qmVYBFUb0lmr7ak?e=JLeADm)

**CNA:** GPL Odorizers recommends users clear the old files from their microSD cards, keeping only the LOGS folder and the FIRMWARE.LIC file if they have a WebMI license. The compressed folder downloaded from the link above can then be extracted to the root directory

of the microSD card. These files already include the corresponding firmware update. If users do not have IT permissions to access their microSD cards, GPL Odorizers can provide preconfigured SD cards that technicians can simply swap into their odorizers prior to installation.

**CNA:** For assistance in updating GPL Odorizers to the latest version, users should reach out to GPL Odorizers directly via phone number (303) 697-6701 during the hours of 8:00 a.m. to 4:00 p.m. MST.

**CNA:** Horner Automation offers firmware version 15.76 for their XL Series and version 17.30 for their XL Prime Series controllers. An installation guide is available for both the XL series and the XL Prime series. <https://hornerautomation.com/controller-firmware/>

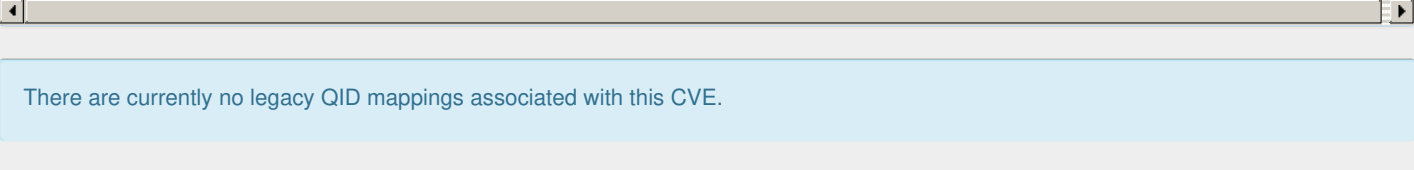

There are currently no legacy QID mappings associated with this CVE.

© [CVE.report](https://cve.report) 2026 |

Use of this information constitutes acceptance for use in an AS IS condition. There are NO warranties, implied or otherwise, with regard to this information or its use. Any use of this information is at the user's risk. It is the responsibility of user to evaluate the accuracy, completeness or usefulness of any information, opinion, advice or other content. EACH USER WILL BE SOLELY RESPONSIBLE FOR ANY consequences of his or her direct or indirect use of this web site. ALL WARRANTIES OF ANY KIND ARE EXPRESSLY DISCLAIMED. This site will NOT BE LIABLE FOR ANY DIRECT, INDIRECT or any other kind of loss.

CVE, CWE, and OVAL are registered trademarks of [The MITRE Corporation](https://mitre.org) and the authoritative source of CVE content is [MITRE's CVE web site](https://mitre.org/cve). This site includes MITRE data granted under the following [license](#).

**Free CVE JSON API** [cve.report/api](https://cve.report/api)

**CVE.report and Source URL Uptime Status** [status.cve.report](https://status.cve.report)